 
 



Strip the cable and comb out the screening braid.



Then slide the pressure screw, washer, gasket and clamping ring onto the cable (clamping ring only till cable sheath) and bend back the screening braid over the clamping ring. Temporary tin plating the inner conductor.



Slide the insulating socket as far as possible to the dielectric on the inner conductor.

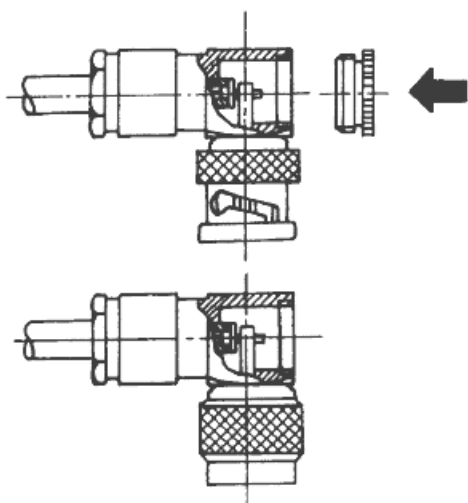

Insert the cable as far as possible in the plug or socket connection and tighten the pressure screw. Remove excess solder. Tightly screw the locking screw.

*for Series BNC 75 Ohm Standard, BNC 50 Ohm, BNC HD eco, BNC HD, TNC 75 Ohm, TNC 50 Ohm

| Assembly Instruction 11 | a | b | c |
|-------------------------------------|------|-----|-----|
| Inner conductor - solder connection | 10.5 | 4.0 | 4.0 |
| Outer conductor - clamp connection | | | |