




Strip the cable.



 
Then slide the pressure screw, clamping sleeve, gasket and clamping ring onto the cable (clamping ring only till cable sheath). Use the expanding mandrel to widen the screening braid.

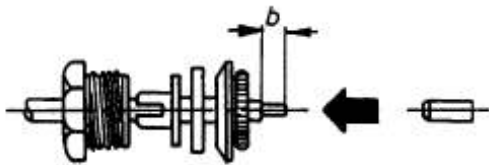


Bend back the screening braid over the clamping ring. Cut the dielectric to dimension 'b' and slide the insulating socket on the dielectric under the braiding.



Temporary tin plating the inner conductor. Slide the contact pin or contact socket as far as possible to the dielectric on the inner conductor and solder by the transverse hole. Remove excess solder.



 Insert the cable as far as possible in the plug or socket connection and tighten the pressure screw.



*for Series BNC 75 Ohm Standard, BNC 50 Ohm, BNC HD eco, BNC HD, TNC 75 Ohm, TNC 50 Ohm

Assembly Instruction 26	a	b
Inner conductor - solder connection	11.5	3.5
Outer conductor - clamp connection		